

NUMBER: 23-019-02

GROUP: Body

DATE: May 20, 2002

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retreival system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of DaimlerChrysler Corporation.

SUBJECT:

Cloth Covers On Both Front Seat Cushions May Loosen And Wrinkle

OVERVIEW:

This bulletin involves the replacement of both front cloth seat cushion covers and pads.

MODELS:

2002	(WJ)	Grand Cherokee
2002	(WG)	Grand Cherokee

NOTE: THIS BULLETIN APPLIES TO GRAND CHEROKEE VEHICLES EQUIPPED WITH CLOTH SEATS (SALES CODE E7 OR K7) AND BUILT PRIOR TO APRIL 04, 2002 (MDH 0404XX FOR WJ) AND MAY 10, 2002 (MDH 0510XX FOR WG).

SYMPTOM/CONDITION:

One or both front seat cushion pad(s) may sink away from the cloth seat cover and towards the seat frame. When this occurs the seat cover material may loosen. The excess seat cloth material may gather near the center of the seat cushion and appear as a raised wrinkle (a tenting or bridging appearance).

DIAGNOSIS:


If the customer describes the above condition, and the condition is present, perform the Repair Procedure to both front cloth seat cushion covers and pads.

Qty.	Part No.	Description	
1	05093494AA	Pad, Seat Cushion (Right)	
1	05093495AA	Pad, Seat Cushion (Left)	
1	0XR861DVAA	Cover, Cloth Seat (Dark Slate - Right)	
1	0XR861T5AA	Cover, Cloth Seat (Sandstone - Right)	
1	0XR861L5AA	Cover, Cloth Seat (Taupe - Right)	
1	0XR871DVAA	Cover, Cloth Seat (Dark Slate - Left)	
1	0XR871T5AA	Cover, Cloth Seat (Sandstone - Left)	
1	0XR871L5AA	Cover, Cloth Seat (Taupe - Left)	
(AR) 1	05093493AA	Kit, Trim Retainers	

PARTS REQUIRED:

REPAIR PROCEDURE:

1. Replace both front cloth seat cushion covers and pads. For more detailed instructions, refer to the Body - Seats - Front Seat Cushion/Cover Section in the appropriate 2002 Grand Cherokee Service Manual (WJ or WG) (Fig. 1).

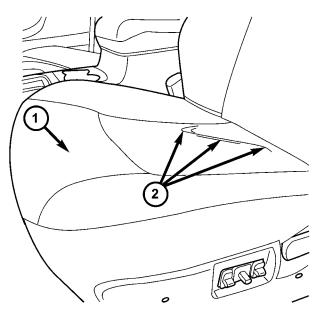

80f92182

Fig. 1 LOOSE SEAT COVER CLOTH

- 1 Cloth Seat Cover
- 2 Raised Wrinkle or Tenting Appearance

POLICY:

Reimbursable within the provisions of the warranty.

TIME ALLOWANCE:

Labor Operation No:	Description	Amount
23-20-36-94	Cover and Pad, Front Seat Cushion - Replace - Both Front Seats	1.1 Hrs.

FAILURE CODE:

P8 New Part
