

NO: 23-14-99

SUBJECT: Door Weather Seal Retention

DATE: May 21, 1999

OVERVIEW:

This bulletin involves installing foam tape on door seal flange to assure proper sealing and retention.

SYMPTOM/CONDITION:

The door weather seals may not fit the door flange properly. This can cause loose or sagging door seals and the associated wind and water leaks.

DIAGNOSIS:

Inspect the door weather seals. If the seals are loose or sagging and do not fit tightly on the flange, perform the Repair Procedure.

PARTS REQUIRED:

Qty.	Part No.	Description
AR	04318028	Foam Tape

REPAIR PROCEDURE:

THIS REPAIR IS COMPATIBLE WITH DAIMLERCHRYSLER'S MOBILE SERVICE PROGRAM AND DOES NOT REQUIRE HOISTS OR OTHER FULL SERVICE FACILITY SPECIAL EQUIPMENT.

1. Open the door and pull the door seal down away from the flange.
2. Apply three 12-inch strips of foam tape, p/n 04318028, to the flange in the areas shown (see [Figure 1](#)) for each affected door.
3. Install the seal making sure that the seal is fully seated on the flange.

POLICY:

Reimbursable within the provisions of the warranty.

TIME ALLOWANCE:

Labor Op. No.	Time
23-51-09-93	0.2 Hrs.

FAILURE CODE:

Code	Description
------	-------------

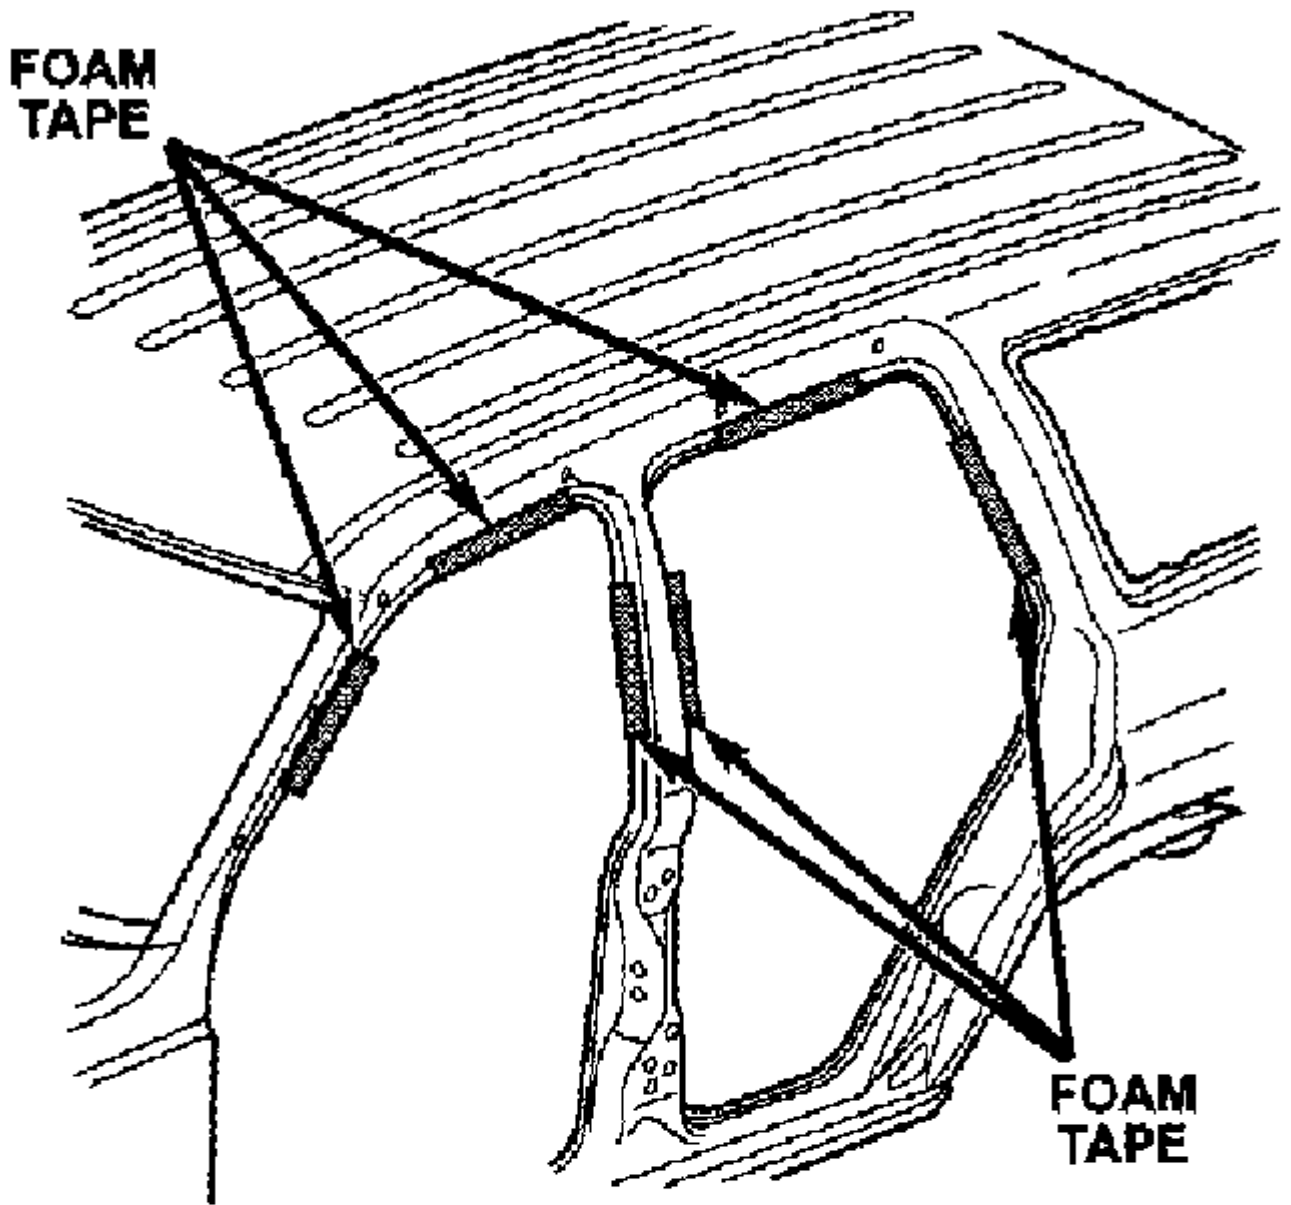


FIGURE 1